



# Tech Tip

## February 2026





### ERR 203.00 Technician initiated mitigation

Link systems using 5STEMC ahu will produce error code 203.00 technician initiated mitigation when the supply air temperature sensor is plugged into the test pins on the mitigation board.

This is occurring because the ohms resistance is low enough to simulate that the test pins have been shorted together.

The supply temp sensor should be plugged into the AHC board on J11 which is the larger of the 2 boards.

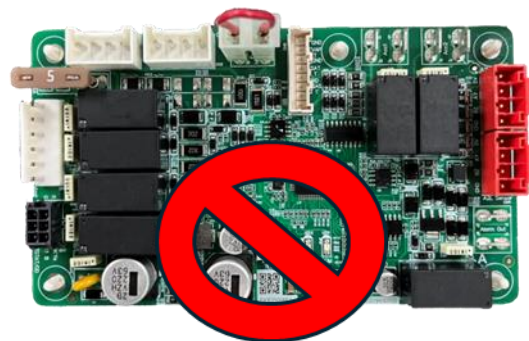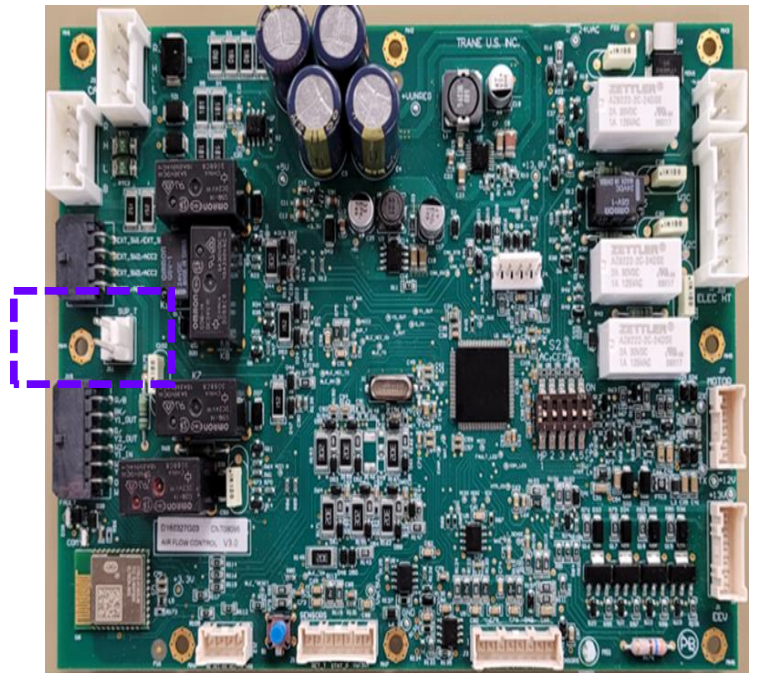

**Field Service Representative Contact**

**1-844-FL- TRANE  
1-844-358-7263**