



Tech Tip


December 2025

Heat Mode OD EEV pumping down

If you have a pump down in heat mode with an ODU with EEV in heating check faults:

- Fault 1 Stepper motor
- Fault 2 Control Failure
- Fault 3 Suction Pres Transducer
- Fault 4 Suction Temp sensor

No faults found board will need to relearn the temperature pressure chart to target proper superheat at the ODU.

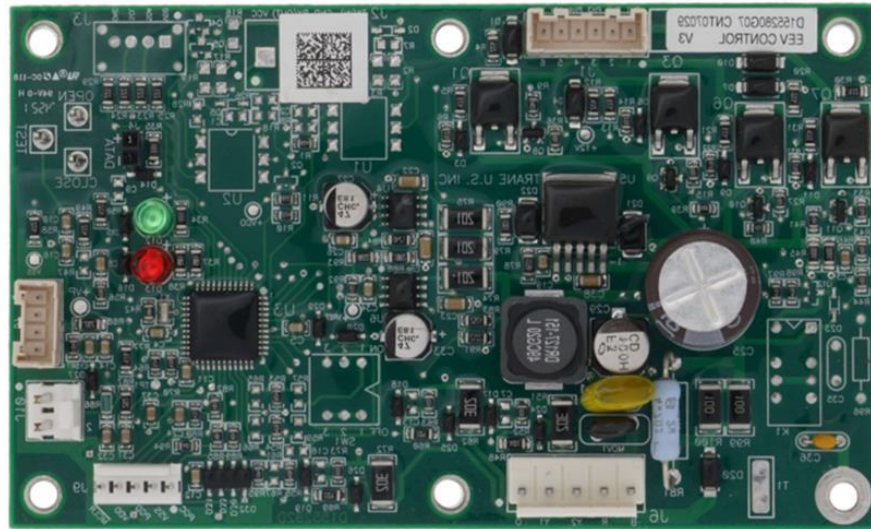

Short between test and open on the EEV board and then pull the plug of the stepper motor on the EEV board. Run the unit for 15 to 20 minutes to allow the board an opportunity to relearn the TP chart programmed into the board.



Field Service Representative Contact

Trane® Technician

1-844-358-7263



Symbio® Service & Installation